

Directions for Everbrite[™] on Aluminum

For use on Faded, Chalky, Stained Anodized Aluminum, Powder-Coated or Painted Aluminum

The amount of cleaning needed will depend on the surface condition. If the aluminum is only faded, it can be washed with EZ-Prep and water to remove any dirt and grime. For heavily oxidized, stained or pitted aluminum, additional scrubbing will be necessary. Make sure that the surface is clean and completely dry before application of the coating.

- 1. Wet the surface with water first.
- 2. Wash using diluted (1 oz. per gallon of water) EZ-Prep™ Cleaning Concentrate. Using a brush (a soft car wash type) or a clean microfiber towel. This process removes any residual oils and dust.
- 3. If heavy chalk, oxidation, stains or pitting is present: Use Prep Pads or other approved scrubber to scrub the surface to remove chalk and oxidation. A blue or white ScotchBrite® pad or fine (000 or 0000) synthetic steel wool pad will also work. (Do not use regular steel wool it can leave particles that will rust.)
- 4. Rinse with fresh water until the water sheets off of the metal. (do not allow any soap mixture to dry on the surface).
- 5. If any oxidation remains, wipe with a clean, damp microfiber cloth.
- 6. Solvent Wipe Required for Bare Metal Surfaces. If the metal is painted or powder coated, skip this step. Solvent wipe the metal with xylene or denatured alcohol to remove any traces of residue. This step needs to be done immediately before coating. Do NOT dilute or rinse the solvent. This step will ensure a completely clean and dry surface. Skipping this step on bare metal can result in poor adhesion of the coating. (Solvent not included in kits) Do NOT use Isopropyl Alcohol as it leaves a film.

Thorough preparation is very important. If you try to take shortcuts on preparation, you will likely not achieve the intended results. How the surface looks when clean and wet is how it will look coated. Be sure the item appears the way you want it to look before you apply the coating. The article to be coated must be clean and dry before application of the coating.

MATERIALS NEEDED

- Everbrite[™] protective coating
- Applicator: clear-coat applicator, foam brush, microfiber roller or a natural bristled paint brush.
- Metal or glass pan-: a metal paint pan or disposable mini loaf pans work well.
- Personal Protection: Nitrile or chemical protective gloves to protect your hands. (Rubber gloves will get sticky)
- If spraying any coating, eye protection & NIOSH respirator is recommended.

APPLICATION OF COATING

Apply the coating to a completely clean and dry surface. Warming the metal with heat gun will help ensure metal is dry. Allow metal to cool before coating. Do not apply the coating if the metal is hot to the touch.

- **1.** Pour the coating into clean, dry, metal or glass pan. *Do not use plastic as the solvent can melt plastic.* DO NOT DILUTE COATING.
- 2. For application, use a clear-coat applicator, microfiber roller, natural-bristled paintbrush, paint applicators, clean dry lint-free white cloth, aerosol can or paint sprayer with a 3-10 fine-finish tip. If using a cloth, fold it into a pad. `
- **3.** Submerge applicator completely into the coating. Squeeze out just the excess. Applicator should be saturated but not dripping. This is important as dry areas in the applicator can cause streaks.
- **4.** Apply the coating to the surface letting the applicator "glide" across the surface. <u>Do not press hard.</u> Applicator should glide smoothly. When it starts showing resistance, dip the applicator again. If you get drips, simply smooth them out before the coating starts to dry. Observe the coating while applying: if the coating separates or does not look completely smooth, **STOP** and re-clean the surface. Other chemicals present on the surface can cause separation and need to be removed completely. Silicone is a common coating agent which can be removed with mineral spirits (*available at hardware stores*). Once removed, complete Step 3 (Solvent Wipe) again.
- 5. Let the coating dry completely. It will self-level as it dries. If you see an area you missed, let it dry and then coat over the missed area. Everbrite coatings are self-annealing; meaning the second coat will become part of the first coat. Wait at least one hour between coats or until the previous coat is completely dry.
- 6. CURE TIME: Under normal circumstances & with good ventilation, the coating will be fully cured after 4-5 days. The coating will be delicate until it is fully cured. You can shorten cure time by gently heating the coating <u>AFTER</u> it is dry to the touch. Coating <u>MUST</u> be cured before prolonged contact with other surfaces, for example, packaging, allowing water to sit on the coated surface, immersing in water or filling fountains, etc. In most cases, dew or rain does not hurt the coating once it is dry to the touch.

CLEAN UP: Roller covers, sponge brushes and applicator pads are discarded after use, but they will last for a short while between coats if they are wrapped in aluminum foil. Brushes and spray tips are cleaned up with xylene or lacquer thinner.

AFTER CARE: Do NOT use solvent based cleaners or abrasives to clean coated metal. Do not use cleaners with "petroleum distillates". Suggested cleaners: Windex, mild soap & water or similar mild cleaners.

MAINTENANCE & LONGEVITY: Once coated, the coating is easy to maintain. As long as the original coating is still intact, wash the surface with a mild dish soap and water, dry well, and recoat. It is best to recoat before any tarnish or oxidation is seen or at the first sight of slight color change. The longevity of the coating is dependent on proper application of the coating, its environment, and general use and abuse. See Maintenance Instructions on our website.

COATING REMOVAL: Coating can be removed from Anodized Aluminum with a solvent like Xylene or a Xylene substitute. Care needs to be taken when removing coating from painted metal; contact customer service (916) 852-0200.

SHELF LIFE OF COATING: Coating has an indefinite shelf life when stored in the closed, original container. Keep any extra coating for touch ups. We recommend cleaning the threads of the container before reattaching the lid to avoid sticking.